

# Work Order ID 50761

July 21, 2009 2:31:11 PM

Page 1

Item ID: D2580-1

Accept

Setup Start

Revision ID: D

Stop

Item Name: 205 Skidtube bent detail

Start Date: 07/23/2009 Start Qty: 6.00

Cust Item ID:

Required Date: 07/31/2009 Req'd Qty: 6.00

Customer:

Reference:

Approvals:

Process Plan: MF

Date: 09-07-21

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/  
Work Center ID

Operation  
Description

Set Up/  
Run Hours

Draw  
Number

Draw  
Rev.

Plan  
Code

Accept  
Qty

Reject  
Qty

Reject  
Number

Insp.  
Stamp

Draw Nbr

Revision Nbr

D2580

Rev D

100

0.00

HandFinish

Memo

0.00

Hand Finishing

1- Inspect mat'l D2500-1-190 for damage.

2- Chemical Conversion Coat as per QSI 005 4.1

110

0.00

Skidtubes

Memo

0.00

Skidtubes

1-Drill pilot holes using drill jig DT 8149 (Do not use cutting fluid)

2-Open holes to 0.500" as per Dwg D2580 without cutting fluid

3-Deburr and blow out all chips from inside of tube

4-Bond web in place per QSI 015.

Pick:

Qty ☐ Part Number ☐ Description ☐ Batch

A/R ☐ ☐ Sikaflex-291 ☐

Sikaflex expire date: ☐

M111557 EXP 01/2010  
M12391 EXP 02/2010

6

11 9-8-10

6

BE 9-8-13

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Work Order ID 50761

July 21, 2009 2:31:11 PM



Page 2

Item ID: D2580-1

Accept



Setup Start



Revision ID: D

Stop



Item Name: 205 Skidtube bent detail

Start Date: 07/23/2009 Start Qty: 6.00



Cust Item ID:

Required Date: 07/31/2009 Req'd Qty: 6.00



Customer:

Reference:

Run Start



Approvals: Process Plan: \_\_\_\_\_ Date: \_\_\_\_\_ Tooling: \_\_\_\_\_ Date: \_\_\_\_\_

Stop



QC: \_\_\_\_\_ Date: \_\_\_\_\_ SPC (Y/N): \_\_\_\_\_ Date: \_\_\_\_\_

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	----------------	--------------	--------------	---------------	---------------	------------------	----------------

120

QC3- Inspect Part Finish

0.00



QC

Memo

0.00

Quality Control

⑥

11 9/8/57

130

QC5- Inspect part completeness to step on W/O

0.00



QC

Memo

0.00

Quality Control

DP

⑥

9-8-17

140

Identify as per dwg & Stock Location: LG

0.00



Packaging

Memo

0.00

Packaging

DP

⑥

9-8-17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

**Work Order ID 50761**

July 21, 2009 2:31:11 PM

Page 3

Item ID: D2580-1

Accept

Revision ID: D

Item Name: 205 Skidtube bent detail

Start Date: 07/23/2009 Start Qty: 6.00

Required Date: 07/31/2009 Req'd Qty: 6.00

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

QC:

Date:

SPC (Y/N):

Date:

Run Start

Stop

Sequence ID/  
Work Center IDOperation  
DescriptionSet Up/  
Run HoursDraw  
NumberDraw  
Rev.Plan  
CodeAccept  
QtyReject  
QtyReject  
NumberInsp.  
Stamp

150

QC21- Final Inspection - Work Order Release

0.00

QC

Memo

0.00

Quality Control

09/08/19  
MF 09-08-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

# Picklist Print

Page 1

July 21, 2009 2:31:11 PM

Work Order ID: 50761



Parent Item: D2580-1RevD



Parent Item Name: 205 Skidtube bent detail

Start Date: 07/23/2009

Required Date: 07/31/2009

Comments:

Start Qty: 6.00

Required Qty: 6.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D2500-1-190RevU/R 		Manufactured	No			100	Each	0.0000	6.0000			
Ext'n - 'I' Beam Tube 4"												
D2596RevD 		Manufactured	No			110	Each	4.0000	6.0000			
Web, 205 Skidtube												

B50166 ② H 9-8-10

B 46463 ④

B-50763 ⑥ BE 7-8-13

<u>Warehouse</u>	<u>Loc Qty</u>	<u>Loc Code</u>
<u>Location</u>		
Main Warehouse		
LG	4	
50361	4	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

**DART****RELEASED**  
07-06-28 #

DESIGN <i>[Signature]</i>	DRAWN BY <i>[Signature]</i>	<b>DART AEROSPACE LTD</b> HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D2580	REV. D SHEET 1 OF 3
DATE 07.02.27		TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
A	96.09.16	NEW ISSUE	
B	96.12.02	AS MANUFACTURED	
C	98.08.26	REDRAWN, INCLUDED DEO 9094/9097	
D	07.02.27	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/9183	

QTY -041	QTY -045	Part Number	Description
X		D2580-041	SKIDTUBE ASSEMBLY
	X	D2580-045	SKIDTUBE ASSEMBLY
1	1	D2500-1-190	EXTRUSION
1	1	D2576-3	STEP
20	24	D2579	CROSS BOLT SPACER
16	16	D2594-1	PLUG
16	16	D2594-3	O-RING
1	1	D2596	205 WEB
1	1	D2855	AFT CAP
1	1	D3564-5	WEARSHOE
1	1	D3564-9	WEARSHOE
1	1	D3564-11	WEARSHOE
1	1	D3564-13	WEARSHOE
2	2	D3566-1	GASKET
1	1	D3566-5	GASKET
1	1	D3566-13	GASKET
50	50	ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
50	50	AN3C4A	BOLT
2	2	AN3-5A	BOLT
50	50	AN960C10L	WASHER
2	2	AN960JD10L	WASHER

**GENERAL NOTES:**

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) ALL DIMENSIONS ARE IN INCHES
- 3) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 4) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 5) USE DART DRILL TEMPLATE TD2577-205 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTION D-D (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND AN960C10L WASHERS WITH SIKAFLEX-241/-291.
- 6) WELDING TO BE DONE PER DART QSI 004.
- 7) FINISH:  
SEE NOTES ON  
PAGE 2 FOR D2580-041 AND  
PAGE 3 FOR D2580-045
- 8) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES).

**Copyright © 1996 by DART AEROSPACE LTD**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

50 1920s #  
10-20-60 mm



Diagram illustrating the underside of the D2576-3 step, showing the locations for grinding flush and the location ridge on the underside of the D2576.

Labels and features:

- GRIND FLUSH (4 PLACES)
- GRIND FLUSH
- D2576-3 STEP
- LOCATION RIDGE ON UNDERSIDE OF D2576
- $\frac{1}{4}$

[illegible]

D2579 SPACER

D2596 WEB (REF)

AL57-1032-130 (REF)  
(TYP 50 PLACES)

5

AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO Ø0.437 X 1.00 DEEP

i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY GLOSS WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4

37.50  
DISTANCE TO AFT END  
OF D2598 WEB

3  
7

1.750 1.750

#0.508 (TYP.)  
(40 PLACES)

REFER TO DETAIL A

REFER TO DETAIL A

8.750

17.375

26.000

34.188

57.313 (REF)  
7 EQUAL SPACES  
8.188 PITCH

38.0

91.500

190.0  
(D2500-1)

D3566-041 ASSEMBLY DETAIL

WELD AS PER DETAIL B

BLACK ANTI-SKID TO 0.5 ABOVE LOCATION RIDGE

BLACK ANTI-SKID TOP OF STEP TO 0.5 ABOVE BOTTOM EDGE

0.5 1.5 1.5 0.5 1.5 1.5 0.5

8

P P P P P P P

REFER TO DETAIL C

D3566-1 D3566-5 D3566-13 D3564-11 D3564-5 D3564-9 D3564-13

AN3C4A BOLT (1)  
AN960C10L WASHER (1)  
(50 PLACES)


DESIGN	DRAWN BY
--------	----------

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DRAWN BY	PH
APPROVED	H


DRAWING NO.	REV. D
D2580	SHEET 2 OF 3
TITLE	SCALE
205 SKIDTUBE ASSEMBLY	1:24

**DETAIL E**  
SCALE 5:24

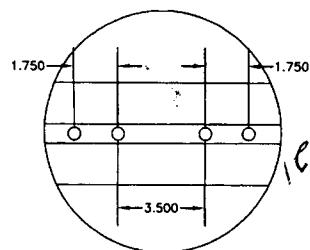


1.750  
10-10-60 jms  
192054

**DETAIL F**  
SCALE 5:24

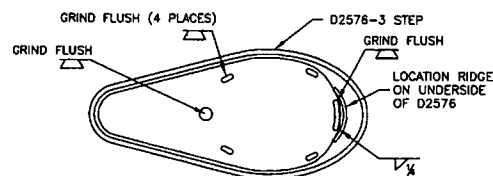


RELEASED  
07-06-28

**DETAIL G**  
SCALE 5:24

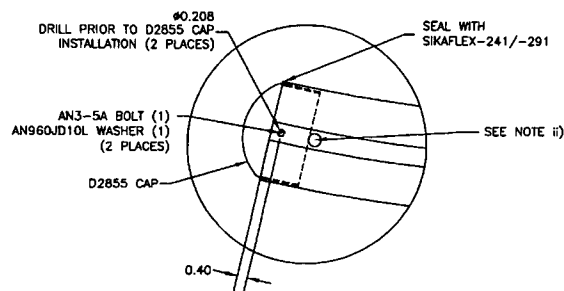

**SECTION H-H**  
**SCALE 5:24**

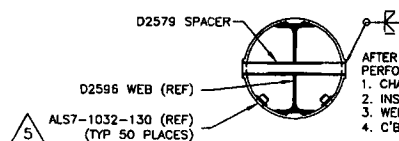


AFTER DRILLING AND BENDING ASSEMBLY  
PERFORM THE FOLLOWING FOR #0.508 HOLES ONLY:

1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (20 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. C'BORE D2579 SPACER TO 0.437 X 1.00 DEEP


**D2580-045 NOTES**

- i) FINISH: ACID ETCH, ALODINE PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB  
POWDER COAT ENTIRE ASSEMBLY GREEN (REF. 4.3.5.8) PER DART QSI 005 4.3  
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4
- ii) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE  
WITH THE SPACER AT THIS LOCATION


**D2580-1 DRILLING DETAIL**

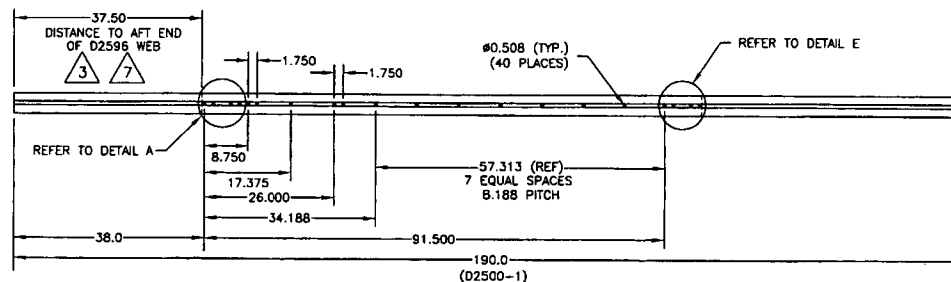

**D2580-5 BENDING AND CUTTING DETAIL**  
(MAKE FROM D2580-1 DRILLING DETAIL)

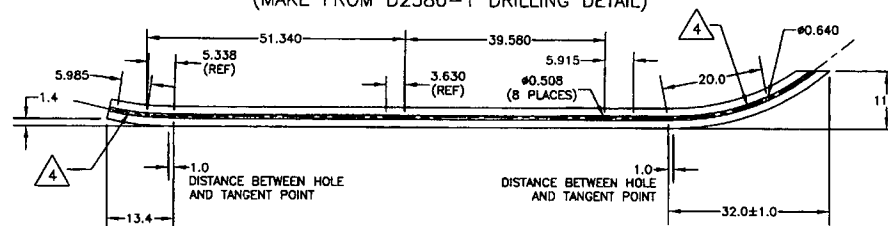

D2580-045 ASSEMBLY DETAIL

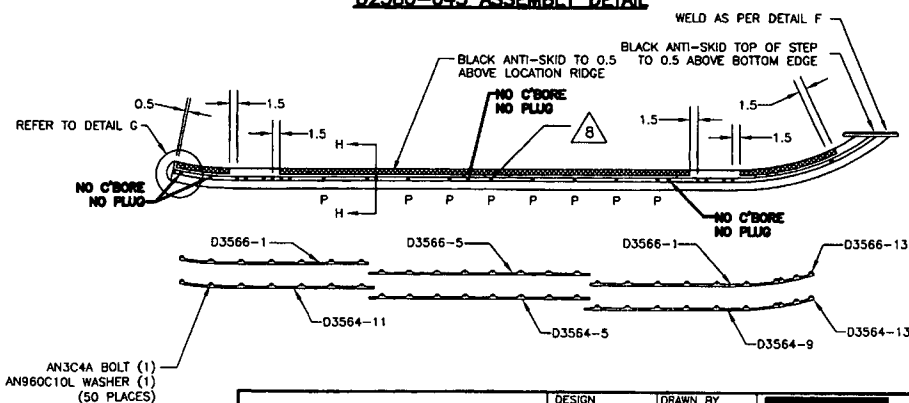

**COPYRIGHT © 1996 BY DART AEROSPACE LTD.**

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL  
AND IS SUPPLIED ON THE EXPRESS CONDITION  
THAT IT IS NOT TO BE USED FOR ANY PURPOSE  
OR COPIED OR COMMUNICATED TO ANY OTHER  
PERSON WITHOUT WRITTEN PERMISSION FROM  
DART AEROSPACE LTD.

DESIGN

1. A

CHECKED

CHECKED

L

DATE \_\_\_\_\_

07.02

DRAWN BY

21

	APPROVED
--	----------

APPROVED

[illegible]

---

**DART**

**DART AEROSPACE LTD.**  
HAWKESBURY, ONTARIO, CANADA

DRAWING NO.

02580

01000
005

1102

205	S
-----	---

REV. D  
SHEET 3 OF 3

REV. D

SHEET 3 OF 3

3 OF 3

---

CONF

SCALE

1:24